

MARION COUNTY SURVEYOR'S OFFICE



SECTION CORNER RECORD

DEBRA S. JENKINS
MARION COUNTY SURVEYOR

SEC. 11 TWN. 15_N RNG. 4_E

BRYAN F. CATLIN, PLS
TECHNICAL SUPERVISOR

Date: 10-13-09
Party Chief: Wilcoxon
Crew: Finney
Type of Marker: Cut 'x' see note
Method of Establishment: County: 4-18-1995
IN S.P.C. E Zone, NAD 83
Name: 15041101
N: 501 860.638 0(m)
E: 65 948.893 0(m)

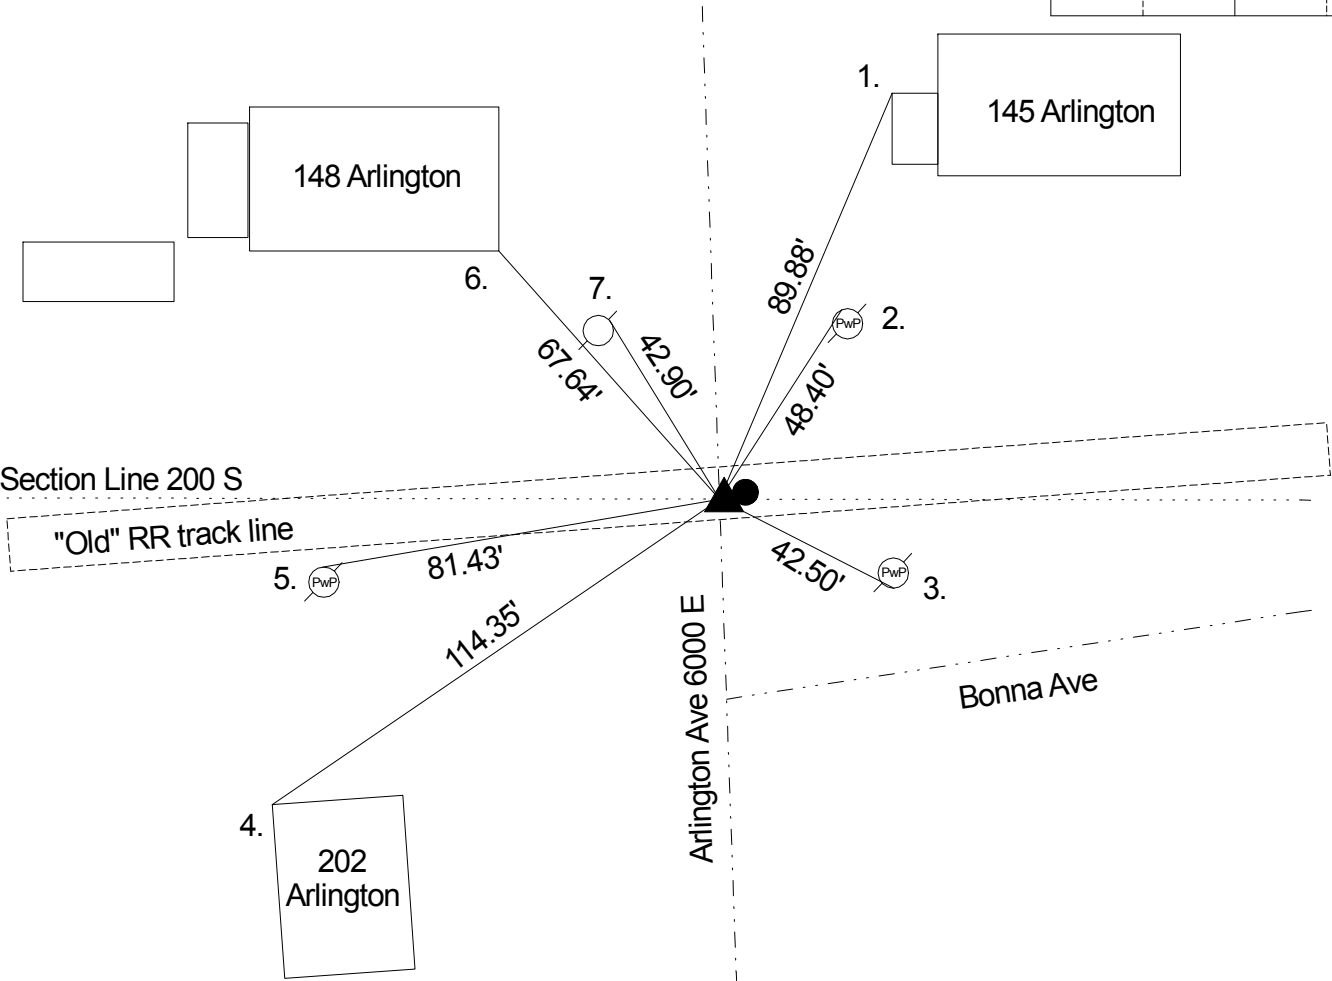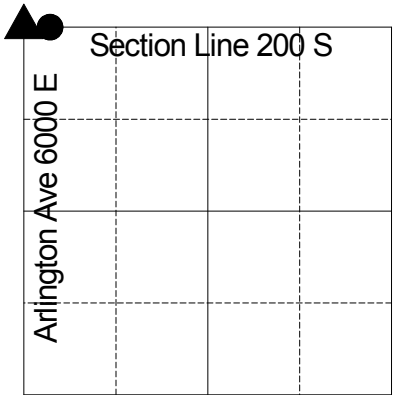

Corner referenced by Miller on 5/2/1975 by Miller and called a RR spike. Corner referenced by Bruer on 11/29/78 and called a brass plug .Corner referenced by MCSO on 5/8/81 and called a brass plug. Corner referenced by Gries on 8/29/88 and called a brass plug. Corner referenced by Kiste on 10/19/94 and called a brass plug. Corner referenced by Wilcoxon on 4/18/95 and a cut x was set by 1975 ties. The cut x falls 0.37' N & 0.05' W of the brass plug which we believe was set incorrectly. Corner referenced by Wilcoxon on 2/19/1999 and called a cut x. Corner referenced by Wilcoxon on 6/5/2004 and called a cut x. Corner referenced by Wilcoxon on 10/13/09 and called a cut x.

REF.	DISTANCE	DESCRIPTION
1.	89.88'	NW Porch Slab for house #145
2.	48.40'	PK nail N PwP #1-546 A 6" up
3.	42.50'	PK nail S PwP #79-546 B 8" up
4.	114.35'	NW corner of brick for house #202
5.	81.43'	Small PK nail N PwP no # 12" up
6.	67.64'	SE corner of foundation for house #148
7.	42.90'	Small PK nail NE guide pole 15" up

Note : Cut 'x' falls 0.37' N & 0.05' W of brass plug which was set in 1978. We believe the plug to be set in an incorrect position. See DOT Project (4.23 A.11) ST-33-018
P.R.C. 47 +68.47